

Manhole Inspection Summary

Manhole # S35M__035MH

Printed On: 2/12/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **35M** Node: **035** Status: **Found**

Insp Date: **3/25/08 7:58 AM**

Incomplete Comments

Crew: **5**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **10 e. lee**

Cross Street: **light st**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Ponding**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **-1** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **7** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S35M__035MH

Printed On: 2/12/2009

Page 2 of 5

Location View



Top View



misc



bench debris

Defect 5



crack in barrel, more missing mortar at 3

Defect 4



missing mortar at 3 in barrel

Defect 2



Steps

Defect 1



chimney loose bricks,deteriorated, frame leaks

Manhole Inspection Summary

Manhole # S35M__035MH

Printed On: 2/12/2009

Page 4 of 5

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 12.50 (ft.) Flow Characteristics: Fast

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: None


Connects To: Manhole

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow

Drop In @ 3 O'Clock

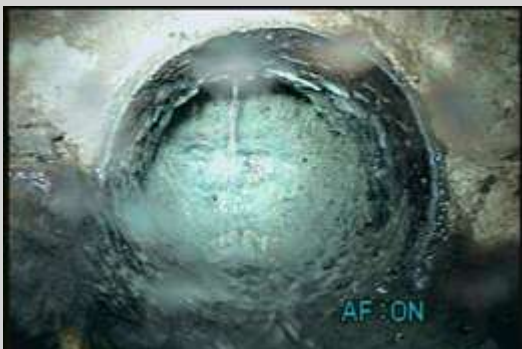

Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 6.40 (ft.) Flow Characteristics: Fast

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ Debris ☒ Grease

Silt Depth: 8 (in.) Deposits Extent: Heavy

Infiltration: Dripper Pipe Seal Cond: Cracked



Drop: Outside Direct

Angled: Reading: 0.00 (ft.)

Inv Depth: 12.80 (ft.)

Drop Condition: Open

Connects To: Connecting Node Not Available

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S35M__035MH

Printed On: 2/12/2009

Page 5 of 5

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



Pipe Height: **0** (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.20** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection